




Instruction Leaflet



546-2526 & 546-2510

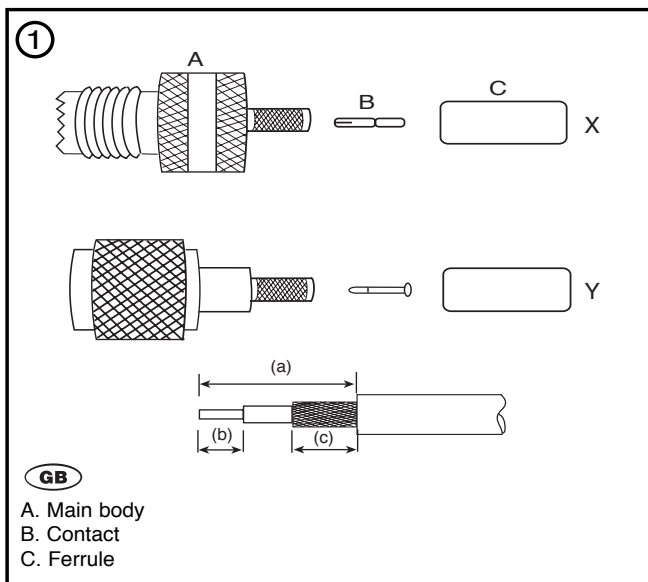

Stock no.	(a)	(b)	(c)
546-2526 (X)	4.0	13.5	7.0
546-2510 (Y)	2.0	11.0	7.0

Assembly instructions

Fit ferrule over cable sheath and prepare cable end as follows. Braid length 6.5mm, dielectric length 3mm, conductor length 5mm. Fit contact onto centre conductor solder/crimp as applicable. Lift braid away from dielectric and slide body over dielectric and under the braid, seating the contact inside the body. Slide the ferrule over the braid (butting against the body) then crimp.

RS Components shall not be liable for any liability or loss of any nature (howsoever caused and whether or not due to RS Components' negligence) which may result from the use of any information provided in **RS** technical literature.